


Installation Instructions:
N-FAB Podium Nerf-Steps
HPC1775CC-TX / HPC1775CC-SS



GM, DIESEL 2017-PRESENT 2500/3500 CREW CAB

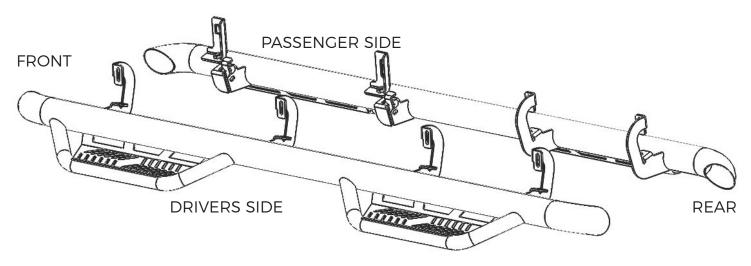

## Hardware:

- 2 M10 x 1.5 x 30mm Black Hex Bolt
- 2 M10 Lock Washers
- 2 M10 Flat Washers, Large OD 28mm OD
- 7 M8 x 1.25 x 25mm Color Zinc Hex Bolt
- 7 M8 Lock Washer, Color Zinc
- 13 M8 x 24mm OD Flat Washer, Color Zinc
- 6 M8 Nylock Nut, Color Zinc
- 8 M8 x 1.25 x 25mm Hex Bolt. Black
- 10 M8 x 24mm OD Flat Washer, Black
- 2 M8 Nylock Nut, Black
- 7 M8 x 20mm U-Nut

## STEP 1:

Identify the driver and passenger bars. Drivers side has four one piece brackets and, passenger side front two brackets are two piece, the rear two are one piece.



STEP 3: Insert spring loaded U nuts to the body of the truck.



Each mounting bracket consist of 2 mounting holes. The upper large hole mounts to the body of the truck and the lower smaller hole to the pitch weld.





STEP 4 (Drivers Side): Carefully place HS2 step into place. Use bolt, washer and begin hand tightening all 4 upper mountings. Best to have a assistant to lift and hold board in place.

STEP 5 (Drivers Side): Insert black head bolt and washer through pinch weld hole and secure with locking nut and washer.





STEP 11 (Passenger Side): Take bracket and feed between the body and the DEF tank from the back of the tank. You'll be able to fit and hand tighten bolt through the bracket to the body.

**STEP 6** (Drivers Side): **Avoid using power or air tools.** Tighten pinch weld mounts first then upper bolts. Tighten to 20ft lbs torque to secure the board to the truck.





STEP 12 (Passenger Side): Carefully place passenger side step into place. Use bolt, washer and begin hand tightening both upper mountings and pinch weld mounting to the rear two brackets Best to have a assistant to lift and hold board in place.

**STEP 7** (Passenger Side): Remove plastic shield from DEF tank on passenger side of the truck.





STEP 13 (Passenger Side): Use 13mm bolt to align 2 piece bracket to the board, insert at the sideand hand tighten. Apply to both first and second bracket.

**STEP 8** (Passenger Side): First bracket has a tab that locates in the OE body mount hole.





**STEP 14** (Passenger Side): Insert bolt and washer going up through board, truck pinch weld and through the 2 piece bracket.

STEP 9 (Passenger Side):
Take bracket and feed
between the body and
the DEF tank, feel and
move until you locate the
tab into the OE hole. The
bracket will hang once
placed correctly.





STEP 15 (Passenger Side): Snug hardware for the first and second bracket. Tighten the bolt going up throught the pinch weld first to pull the board into place. Then tightening both side bolts.

STEP 10 (Passenger Side):
The second bracket
attaches to the body
with a bolt rather
than the tab like
the first bracket.





**STEP 16** (Passenger Side): **Avoid using power or air tools.** Tighten pinch weld mounts first then upper bolts. Tighten all hardware to 20ft lbs torque to secure the board to the truck.